

ÚŘAD PRO CIVILNÍ LETECTVÍ ČESKÁ REPUBLIKA Sekce technická letiště Ruzyně, 160 08 Praha 6 tel: 233320922, fax: 220562270

PŘÍKAZ K ZACHOVÁNÍ LETOVÉ ZPŮSOBILOSTI

Číslo: 2008-0097 Nahrazuje 2008-0080 Datum účinnosti: 03. června 2008

Sicma Aero Seat Model 940()

Tento PZZ je vydáván pro výrobek transferovaný pod působnost EASA

Na základě rozhodnutí EASA je následující Příkaz k zachování letové způsobilosti závazný pro všechny výrobky provozované v EU, na které se daný PZZ vztahuje.

Provedení PZZ, který se vztahuje podle typu a výrobního čísla na výrobek je pro provozovatele/vlastníka letadla zapsaného do leteckého rejstříku závazné. Neprovedením PZZ ve stanoveném termínu dojde ke ztrátě letové způsobilosti výrobku.

Poznámky:

⁻ Provedení tohoto PZZ musí být zapsáno do provozní dokumentace letadla.

⁻ Případné dotazy týkající se tohoto PZZ adresujte na ÚCL sekce technická.

⁻ Pokud to vyžaduje povaha tohoto PZZ, musí být zapracován do příslušné části dokumentace pro obsluhu, údržbu a opravy letadla.

EASA	AIRWORTHINESS DIRECTIVE	
	AD No.: 2008-0097	
	Date: 20 May 2008	
	Note: This Airworthiness Directive (AD) is issued by EASA, acting in accordance with Regulation (EC) No 216/2008 on behalf of the European Community, its Member States and of the European third countries that participate in the activities of EASA under Article 66 of that Regulation.	
continuing airworthiness of an air an aircraft to which an Airworthi	craft shall be ensured by accom ness Directive applies, except in Agency [EC 2042/2003 Annex I	3B. In accordance with EC 2042/2003 Annex I, Part M.A.301, the plishing any applicable ADs. Consequently, no person may operate a accordance with the requirements of that Airworthiness Directive , Part M.A.303] or agreed with the Authority of the State of Registry
Type Approval Hold	er's Name :	Type/Model designation(s) :
SICMA AERO SEAT		Model 940() Series Passenger Seats
ETSO Approval: F.O.136, EASA.210.094		
Foreign AD : Not applicable		
Supersedure : This Airworthiness Directive supersedes EASA AD 2008-0080, dated 28 April 2008.		
ATA 25	Equipment & Furnishings – Passenger Seats – Inspection / Repair / Modification	
Manufacturer(s):	Sicma Aero Seat	
Applicability:	Passenger Seats models 9401, 9402, 9404, 9405, 9406, 9407, 9408 and 9409, all Part Numbers (P/N), except front row and aft facing seat and those modified to 'Amendment B' standard.	
	The affected seats are known to be installed on, but not limited to, ATR 42 and ATR 72 series aircraft.	
Reason:Several occurrences of cracked central and lateral spreaders seats models 9401 and 9402 have been reported to Sicma A		
	This condition, if not corrected, can lead to further cracking of the seat spreaders, causing injury to passengers or crew members during heavy turbulence in flight or in the event of an emergency landing.	
	For the reasons stated above, this Airworthiness Directive (AD) requires repetitive inspections of the affected seats and, depending on findings, the repair or replacement of damaged spreaders with an improved design ('Amendment B' standard). The replacement of all spreaders (i.e. modification to 'Amendment B' standard) terminates the repetitive inspection requirements.	
	This AD, superseding EASA AD 2008-0080, retains the original requirements, but adds a seat model (9409) that was inadvertently missing in the original AD and excludes front row and aft facing seats from the applicability.	

03 June 2008	
Required as indicated, unless accomplished previously:	
(1) Within the next 6 months after 13 May 2008, the effective date of EASA AD 2008-0080, inspect the affected seats in accordance with the instructions of paragraph (§) A item 1 of Sicma Aero Seat (Sicma) Service Bulletin (SB) 94-25-013;	
(2) Depending on the inspection results, within the criteria and the applicable interval as specified in § A-1 Decision Tree of Sicma SB 94-25-013, repeat the inspection as required by § (1) of this AD; or	
(3) When deficiencies or cracks are found during any of the inspections required by § (1) and (2) of this AD, within the threshold defined by the criteria specified in § A-1 Decision Tree of Sicma SB 94-25-013, repair the affected spreaders in accordance with the instructions of Sicma SB 94-25-011, or modify the seat to 'Amendment B' standard, replacing all the spreaders, in accordance with the instructions of Sicma SB 94-25-012;	
Note 1: The aircraft may only be dispatched with non-repaired or unmodified seats within the provisions of the applicable Master Minimum Equipment List item(s).	
Note 2: Any discrepancies discovered during inspections required by this AD should be reported to Sicma Aero Seat, address indicated in the 'Remarks' section of this AD.	
(4) After 13 November 2008, no person shall install any Sicma seat affected by this AD on any airplane as a replacement part, unless it has been modified to 'Amendment B' standard in accordance with Sicma SB 94-25-012;	
(5) The replacement of all spreaders on any affected seat assembly (modification to 'Amendment B' standard) in accordance with Sicma SB 94-25-012 terminates the inspection requirements of this AD for that seat assembly.	
Sicma Aero Seat Service Bulletin No.94-25-011 issue 2	
Sicma Aero Seat Service Bulletin No.94-25-012 original issue	
Sicma Aero Seat Service Bulletin No.94-25-013 issue 4	
The use of any later approved revision of these documents is acceptable for compliance with the requirements of this AD.	
 If requested and appropriately substantiated, EASA can approve Alternative Methods of Compliance for this AD. 	
 The required actions and the risk allowance have granted the issuance of a Final AD with Request for Comments, postponing the public consultation process after publication. 	
 Enquiries regarding this AD should be referred to the Airworthiness Directives, Safety Management & Research Section, Certification Directorate, EASA. E-mail <u>ADs@easa.europa.eu</u> 	
 For any question concerning the technical content of the requirements in this AD, please contact: Sicma Aero Seat, Rue Robert Maréchal Sénior, Z.I. La limoise, 36100 Issoudun, France ; telephone +33 (0) 2 54 03 39 39 ; FAX: +33 (0) 2 54 03 39 00; e-mail : mcoureau@sicma.zodiac.com 	